Metallic wiper edge on the piston



Flat Lever Clamps

Advanced Link System, pneumatic position monitoring optional single and double acting, max. operating pressure 250 bar



Application

The flat lever clamp is a compact hydraulic clamping element for fixtures with oil supply through drilled channels.

Due to the minimum space required, the flat lever clamp is especially suitable for fixtures with little space for the installation of hydraulic clamping elements.

The flat clamping lever allows machining of surfaces that are only a few millimetres above the clamping point.

Double-acting versions are advantageous for time and cycle-dependent installations, since the return stroke is effected in a precisely defined time and the pneumatic position monitoring of the clamping lever is possible.

Advanced Link System

The newly developed lever kinematics enable trouble-free, process-safe operation.

Description

When pressurising the flat lever clamp, a piston moves upwards against the rear edge of the clamping lever and swivels the clamping lever to the clamping position. The piston force is deviated by 180° onto the workpiece. The clamping force depends on the operating pressure and the length of the clamping lever.

When unclamping the flat lever clamp, the clamping lever is swivelled back to the off-position by means of a hook-shaped carrier on the piston. Unclamping is made either hydraulically or when using a single-acting element with spring force.

The pneumatic position monitoring allows the monitoring of both final positions of the clamping lever.

Important notes

Flat lever clamps must only be used for clamping of workpieces in industrial applications and may only be operated with hydraulic oil. Considerable injuries can be caused to fingers in the effective area of the clamping arm.

The manufacturer of the fixture or the machine is obliged to provide effective protection devices.


The clamping lever must not be impeded during swivelling. The clamping height h must be in the indicated tolerance range. To permanently secure correct functioning, the flat lever clamps must be regularly cleaned and greased. This applies especially for dry machining, minimum quantity lubrication and in case of accumulation of very small swarf.


Advantages


- Minimum dimensions
- Partially immersed body
- Mounting without pipes
- Unimpeded loading and unloading of the fixture.
- Workpiece clamping without any side loads
- Flat clamping lever can be swivelled into small recesses
- Long clamping lever (blank) adaptable to the workpiece
- Pneumatic control of the clamping lever position (optional only double acting)
- Metallic wiper edge for piston rod
- Swarf sheet retrofittable
- Mounting position: any

Installation and connecting possibilities

Single acting Double acting

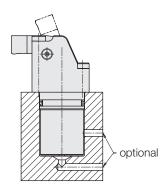

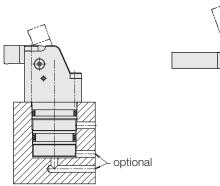

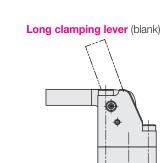

Available versions

 Single acting, without position monitoring

1.1 Without clamping lever 18297X0E00

For the installation of a special clamping lever, which can be produced from the clamping lever blank.

1.2 With clamping lever 18297X0EXX

The clamping lever with length L as per chart (page 3) is installed.

2. Double acting,

without and with position monitoring

With the pneumatic position monitoring, the clamping and/or unclamping position is queried directly at the clamping lever. A description can be found on page 5.

2.1 Without clamping lever, without position monitoring 18297X0D00

For the installation of a special clamping lever, which can be produced from the clamping lever blank.

2.2 Without clamping lever, with position monitoring 18297X3D00

The position monitoring can also be used with the clamping lever blank.


2.2 With clamping lever, without position monitoring 18297X0DXX

The clamping lever with length L as per chart (page 3) is installed.

2.3 With clamping lever, with position monitoring 18297X3DXX

The clamping lever with length L as per chart (page 3) is installed.

Application example

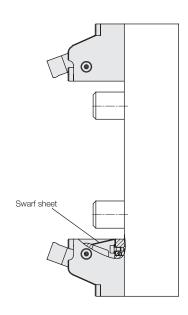

Installation instructions:

The flat lever clamp is suitable for any installation position. If the selected installation position can cause swarf nests to form in the swivel area of the clamping lever, the swarf sheet available as an accessory can be retrofitted.

Dimensions


Single acting 1829 7X0 EXX


Double acting 1829 7X0DXX


Long clamping lever (blank)


see accessories

Material: 42 Cr Mo S4 + QT nitrocarburized




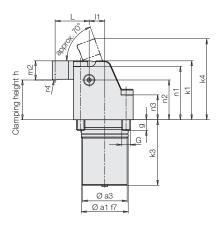

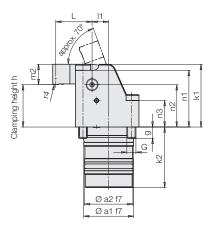

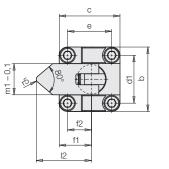


* Only available for position monitoring





Location hole


Location hole

Fixing screws 10.9 – DIN 7984 Included in our delivery Tightening torque see chart.

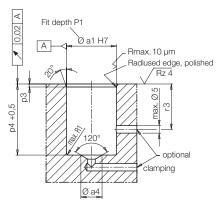

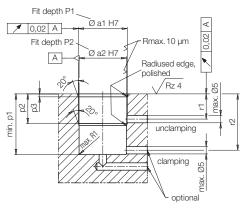

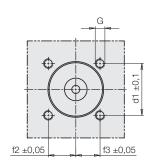

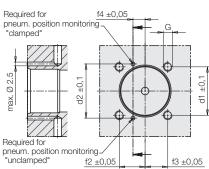

2 O-rings 3 x 1 (part no. 3001758) Included in our delivery

Pneumatic position monitoring see page 5


Technical data

Size			1	2	3	4
Clamping force at 250 bar	single acting	approx. [kN]	2.5	3.3	5.8	9.8
and length of clamping lever L	double acting	approx. [kN]	3.2	5	8.7	13
Piston Ø	single acting	[mm]	16 18/16	20 24/20	25 30/25	32 36/32
Piston stroke	double acting	[mm] [mm]	9.5	11.5	15	18
Oil volume clamping	single acting	[cm ³]	1.9	3.6	7.4	14.5
Oil voidifie diarriping	double acting	[cm ³]	2.4	5.2	10.6	18.3
Oil volume unclamping	double acting	[cm ³]	0.5	1.6	3.3	3.9
Adm. flow rate	single acting	[cm ³ /s]	4	7	13	32
Adm. flow rate	double acting	[cm ³ /s]	5	10	20	40
min. operating pressure		[bar]	20	20	20	20
Max. pressure in return line	single acting	[bar]	0.5	0.5	0.5	0.5
Tightening torque (screws 10.9 I	DIN 7984)	[Nm]	7	12	29	58
Ø a1 H7/f7		[mm]	25	33	40	46
Ø a2 H7/f7		[mm]	24	32	38	44
Ø a3		[mm]	23.8	31.5	37.5	43.5
Ø a4		[mm]	14	14	14	32
b		[mm]	35 33	42 42	53 54	66
c d1		[mm] [mm]	26	32	40	63 50
d2		[mm]	28	35.8	40	50
e		[mm]	24	32	41	47
f1		[mm]	17.5	22	29.5	37
f2		[mm]	13	17	23	29
f3		[mm]	11	15	18	18
f4		[mm]	6.5	8	12.5	15
G		[mm]	M5	M6	M8	M10
g		[mm]	11	7.5	11	13
h clamping height*		[mm]	23 +1.5/-1.2	28 + 2/-1.6	36 +2.4/-1.9	41 +2.8/-2.3
k1		[mm]	32.5	41.5	54	64
k2		[mm]	34	40	46	48
k3		[mm]	38	46.2	45.3	63.5
k4 approx.		[mm]	45	57	72	83.5
k5 approx.		[mm]	59	75	94	110
L		[mm]	18	24	28	33
11		[mm]	10	11	16	20
12		[mm]	30	37	48	57
13		[mm]	45	56	71	85
14		[mm]	22	30	34	41.5
m1 –0.1 m2		[mm] [mm]	16.9 9.5	20.9 13.5	25.9 18	32.9 22.5
n1		[mm]	29	37.5	49	57
n2		[mm]	23	28	36	41
n3		[mm]	9	17.5	24	32
Ø P1		[mm]	11	14	14	14
Ø P2		[mm]	34	32	34	40
p1 min.		[mm]	36	41	46.5	49
p2		[mm]	17	20	20	23.5
p3		[mm]	2	2	3	3
p4 + 0.5		[mm]	39	47	46.5	64.5
r1		[mm]	14	17	16.5	18.5
r2		[mm]	33	35 – 38	40-44	44.5 – 46
r3		[mm]	16 – 36	17 – 44	17 – 44	18-61
r4		[mm]	4	4	8	8
r5		[mm]	2	2	4	4
Single acting, without positio	n monitoring					
Part no. without clamping leve	er		1829710E00	1829720E00	1829730E00	1829740E00
Weight, approx.		[kg]	0.263	0.544	1.040	1.861
Part no. with clamping lever le	ength L		1829710E18	1829720E24	1829730E28	1829740E33
Weight, approx.		[kg]	0.305	0.630	1.225	2.180
Double acting, without clamp	ing lever					
Part no. without position mon	itoring		1829710D00	1829720D00	1829730D00	1829740D00
Part no. with position monitor			1829713D00	1829723 <mark>D00</mark>	1829733D00	1829743D00
Weight, approx.		[kg]	0.246	0.491	0.962	1.576
Double acting, with clamping	lever	-				
Part no. without position mon			1829710D18	1829720D24	1829730D28	1829740D33
Part no. with position monitor			1829713D18	1829723D24	1829733D28	1829743D33
Weight, approx.	3	[kg]	0.288	0.577	1.147	1.895
Accessories		. 91		•		
Part no. clamping lever length	n I		0354 1025	0354 1026	03541027	03541028
· a. · iio. Gairiping level leligti		[kg]	0.042	0.086	0.185	0.319
		INUI				
Weight, approx.	blank)	. 03	0354 1029	0354 1030	UODA IUNI	しいつみ ロバンス
Weight, approx. Part no. long clamping lever (l	blank)		0354 1029 0.066	0354 1030 0.140	0354 1031 0.290	0354 1032 0.537
Weight, approx.	blank)	[kg]	0354 1029 0.066 035381404	03541030 0.140 035381405	0.290 0.35381406	0.537 0.537 035381407

Römheld GmbH

Clamping force diagrams

Calculations of the clamping force

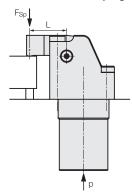

1. Length L of clamping lever is known

1.1 Admissible operating pressure

$$p_{adm} = \frac{B}{(C/L) + 1} \le 250 \qquad [bar]$$

SA
$$p_{adm} = \frac{B^*}{(C/L) + 1} + 5 \le 250$$
 [bar]

1.2 Effective clamping force

DA
$$(p_{adm} > 250 \text{ bar})$$
 Fsp = $\frac{A}{L}$ * 250 [kN]

$$(p_{adm} \le 250 \text{ bar})$$
 Fsp = $\frac{A}{L}$ * p

SA
$$(p_{adm} > 250 \text{ bar})$$
 Fsp = $\frac{A^*}{L} * (250 - 5)$ [kN $(p_{adm} \le 250 \text{ bar})$ Fsp = $\frac{A^*}{L} * (p - 5)$ [kN

$$(p_{adm} \le 250 \text{ bar})$$
 $F_{sp} = \frac{A^*}{L} * (p-5)$

2. Min. length of clamping lever

DA
$$L_{min.} = \frac{C}{(B/p) - 1} \quad [mm]$$

SA
$$L_{min.} = \frac{C}{[B^*/(p-5)] - 1}$$
 [mm]

L, $L_{min.}$ = length of clamping lever [bar]


p, p_{adm.} = operating pressure A, B, C = constants for DA


 A^* , B^* , C = constants for SA


= double acting


SA = single acting

Single acting




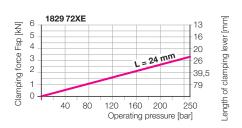


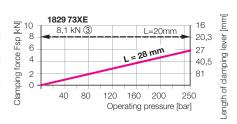


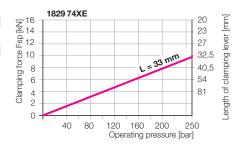


Double acting



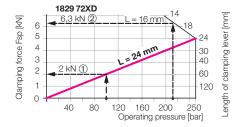

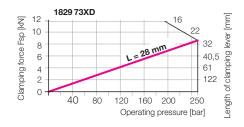

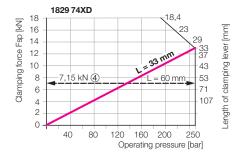

Constants

1829	71	72	73	74
Α	0.23	0.48	0.975	1.716
A *	0.184	0.323	0.663	1.322
В	402.78	385.41	401.77	397.73
В*	509.76	555	578.57	503.37
С	11	13	17	19.5

Example 1: Flat lever clamp 1829723D24 p = 100 bar; L = 24 mm (standard)

Effective clamping force
$$F_{Sp} = \frac{A}{L} \star p = \frac{0.48}{24} \star 100 = 2 \text{ kN}$$

Example 2: Flat lever clamp 1829720D00 p = 210 bar

Min. length of clamping lever
$$L_{min} = \frac{C}{(B/p)-1} = \frac{13}{(385.41/210)-1} = 15.56 \rightarrow 16$$

Admissible operating pressure (review)

$$p_{adm} = \frac{B}{(C/L) + 1} = \frac{385.41}{(13/16) + 1} = 213 \text{ bar}$$

Effective clamping force at 210 bar

$$F_{Sp} = \frac{A}{L} * p = \frac{0.48}{16} * 210 = 6.3 \text{ kN}$$

Example 3: Flat lever clamp 1829730E00 Special clamping lever L = 20 mm

Admissible operating pressure

$$p_{adm} = \frac{B^*}{(C/L) + 1} = \frac{578.57}{(17/20) + 1} = \frac{312 \text{ bar} > 250}{\text{bar}!}$$

Effective clamping force at 250 bar
$$F_{Sp} = \frac{A^{\star}}{L} \star (p-5) = \frac{0.663}{20} \star (250-5) = 8.12 \text{ kN}$$

Example 4: Flat lever clamp 1829740**D**00 Special clamping lever L = 60 mm

Admissible operating pressure
$$p_{adm} = \frac{B}{(C/L) + 1} = \frac{397.73}{(19.5/60) + 1} = 300 \text{ bar} > 250$$

Effective clamping force at 250 bar
$$F_{Sp} = \frac{A}{L} \star p = \frac{1.716}{60} \star 250 = 7.15 \text{ kN}$$

Pneumatic position monitoring


Pneumatic position monitoring

The double-acting flat lever clamps

18297X3DXX

are delivered with optional position monitoring. Depending on requirements, the compressed air is supplied via one or two drilled channels (see page 2).

The required O-rings in the flange are included in the delivery.

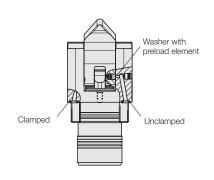

Unclamping position Clamping range

Description

On both sides of the clamping lever is a bore hole in which a washer with an elastic preload element is positioned.

In the guide for the clamping lever in the housing, two bore holes are arranged so that the clamping or unclamping position of the clamping lever will be closed by the preloaded washer.

Important note!


When mounting the clamping lever, the preload elements and the washers must be inserted into the provided bore holes in the clamping lever.

These parts are included in the delivery of all double-acting flat lever clamps that are delivered without the clamping lever.


Monitoring by pneumatic pressure switch

For the evaluation of the pneumatic pressure increase standard pneumatic pressure switches can be used.


Pneumatic port



Function chart

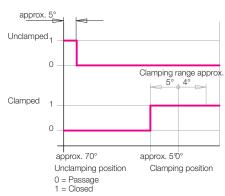

Required flow rate depending on the switching pressure of the pneumatic pressure switch for a pressure drop Δp 2 bar

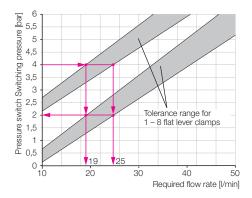

Example


Required switching pressure	4 bar
Pressure drop, if the clamping or unclamping position has not yet been reached.	2 bar
As per diagram: Required flow rate* 1 element	approx. 19 l/min
8 elements	approx. 25 l/min


*) The pneumatic position monitoring is a metallic sealing system in which an air leakage of up to 1.5 l/min per element can occur when closed at 2 bar.


The amount of air leakage depends on the ambient conditions (cleanliness) and should be added to the required volume as per diagram.

5 Römheld GmbH


Cranked clamping arm

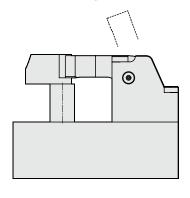



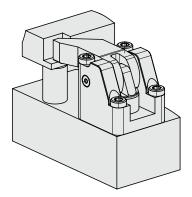

Lateral clamping of workpieces to eliminate the clearance



Römheld GmbH