





Threaded-Body Work Supports with metallic wiper edge, 4 sizes single acting, max. operating pressure 70 bar

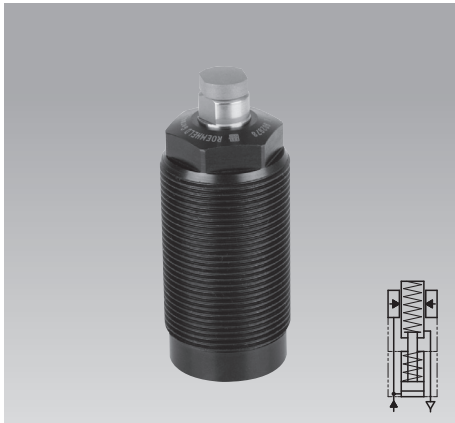


Advantages

- High support force at 70 bar
- 4 sizes available
- Sizes 1 and 2 are available in 2 lengths
- Space-saving threaded-body version
- Metallic wiper edge and FKM wiper
- Connection for venting and positive air pressure protection
- Interior parts protected against corrosion
- Standard flow rate throttle
- Mounting body as accessory
- Mounting position: any

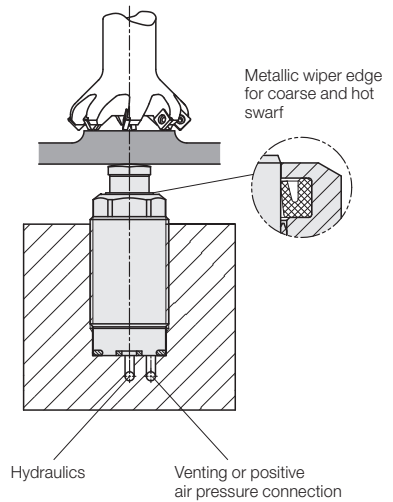

Application

Hydraulic work supports are used to provide a self-adjusting rest for workpieces and avoid their vibration and deflection under machining loads. This series offers very high support forces already at 70 bar and can directly be connected to the low-pressure hydraulic of the machine tool.

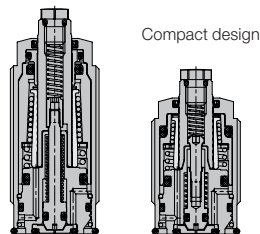

Description


The support plunger is hydraulically extended by a small piston and contacts the workpiece with spring force. The pressure spring can be easily exchanged.

Locking of the support plunger through the slotted clamping sleeve is made by means of a ring-shaped conical hydraulic piston where the locking force is transmitted by a low-friction ball shell.

Unlocking and retracting of the support plunger is made by spring force.



Installation and connecting possibilities

Drilled channels

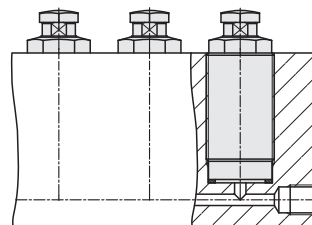

Pipe thread

with accessory mounting body

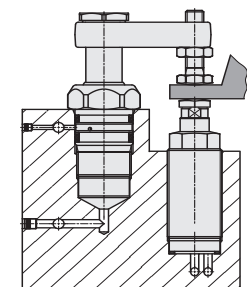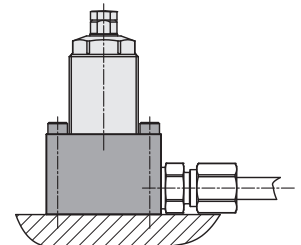

Important notes!

Work supports are not suitable to compensate side loads. The support plunger must not be stressed by tensile load.

The admissible load force is valid for static or dynamic load. Machining forces can generate vibrations, whose amplitude exceeds far an average value, and this can cause yielding of the support plunger.

Safe functioning is only guaranteed with open venting hole.

At the end of the bore hole suction of liquids must be avoided. It is recommended to connect positive air pressure protection with 0.2 bar.

The air sealing must be switched off for unclamping.

The maximum pressure in the return line must not exceed 1 bar.

Work supports must only be operated with a sealed contact bolt.

Operating conditions, tolerances and other data see data sheet A 0.100.

Combination with clamping elements

If clamping will be made onto the work supports, the clamping force must be adjusted to the admissible load, so that there will be still a sufficient reserve to compensate the machining forces.

Rough estimate:

Min. load force $\geq 2 \times$ clamping force


Example

Threaded-body work support 1947 200
Swing clamp 1853 A090 R16
Operating pressure 70 bar

As per diagram:

Adm. load	4.0 kN
– Effective clamping force	2.0 kN
Reserve for machining force	2.0 kN

If this is not sufficient, the pressure for the swing clamp has to be reduced.

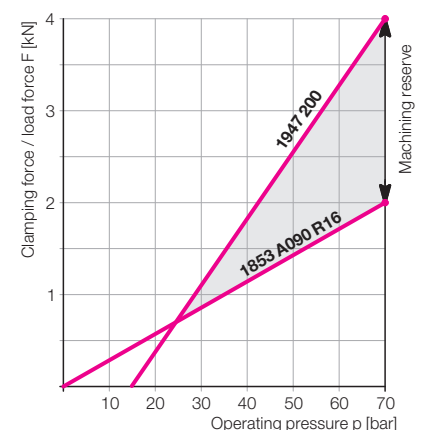

Dimensions

Technical data • Accessories

Size		1 short	1	2 short	2	3	4
Adm. load force (70 bar)	[kN]	1	3	2	4	5.5	10
Load force at p (bar)	[kN]	0.019xp-0.30	0.053xp-0.68	0.035xp-0.46	0.07xp-0.91	0.096xp-1.25	0.175xp-2.28
Support plunger Ød	[mm]	10	10	12	12	15	16
Stroke	[mm]	5	6.5	6	8	8	10
Required oil per stroke	[cm ³]	0.5	0.6	0.6	0.9	1.3	2
Admissible flow rate	[cm ³ /s]	25	25	25	25	25	25
Recommended minimum pressure	[bar]	25	25	25	25	25	25
Max. pressure in the return line	[bar]	1	1	1	1	1	1
Spring force min./max.	[N]	3.7 / 6.6	3.7 / 9.5	5.8/10.9	7.0 / 12.0	9.7 / 14.8	8.5 / 14.8
Elastic deformation with load and 70 bar	[µm/kN]	10	9	8.5	6	6	3.5
Operating temperature	[°C]	0...70	0...70	0...70	0...70	0...70	0...70
Tightening torque	[Nm]	32	32	50	50	63	80
Weight, approx.	[kg]	0.15	0.2	0.2	0.25	0.35	0.75
a	[mm]	48.5	66	52	73	69	82
b	[mm]	40	57	41	62	58	71
c	[mm]	34	49	34	54	49	62
e	[mm]	8.5	8.5	9.5	9.5	9.5	9.5
Ø f-0.1	[mm]	24	24	28	28	34	43
g	[mm]	M26x1.5	M26x1.5	M30x1.5	M30x1.5	M36x1.5	M45x1.5
Ø g1	[mm]	24.5	24.5	28.5	28.5	34.5	43.5
h min.	[mm]	16	16	17	17	18	21
i max.	[mm]	7	7	9	9	8	8.5
Ø k max.	[mm]	8	8	10	10	10	12
Ø k1 max.	[mm]	2.5	2.5	3	3	5	6
l	[mm]	9.5	9.5	11	11	13	15
m	[mm]	5	5	6	6	6	6
n	[mm]	3	3	4	4	4	4
p1	[mm]	45	45	50	50	60	70
p2	[mm]	45	45	50	50	50	55
q	[mm]	35	35	35	35	35	35
r1	[mm]	6.5	6.5	9	9	6	8.5
r2	[mm]	32	32	32	32	38	38
s1	[mm]	4.5	4.5	5	5	6	6
s2	[mm]	36	36	40	40	48	58
t	[mm]	65.5	83	69	90	84	97
Øu	[mm]	5.5	5.5	5.5	5.5	6.5	6.5
v1	[mm]	8.5	8.5	11	11	11	13.5
v2	[mm]	32	32	36	36	38	42.5
v3	[mm]	12.5	12.5	15	15	20	25
w	[mm]	11.5	11.5	11.5	11.5	11.5	11.5
SW 1	[mm]	8	8	10	10	11	11
SW 2	[mm]	8	8	10	10	13	13
SW 3	[mm]	22	22	24	24	30	36
Thread in the support plunger		M6x8	M6x8	M8x12	M8x13	M10x13	M10x13
Part no.		1947102	1947100	1947202	1947200	1947300	1947400



Accessories

Mounting body complete	0346809	0346809	0346810	0346810	0346811	0346812
------------------------	---------	---------	---------	---------	---------	---------

Spare parts

O-ring 1	3002264	3002264	3000335	3000335	3000005	3000028
O-ring 2	3002170	3002170	3001640	3001640	3002171	3002172
O-ring 3	3002167	3002167	3001526	3001526	3000275	3000275
O-ring 4	3000342	3000342	3000342	3000342	3000342	3000342

Mounting body (Accessory)

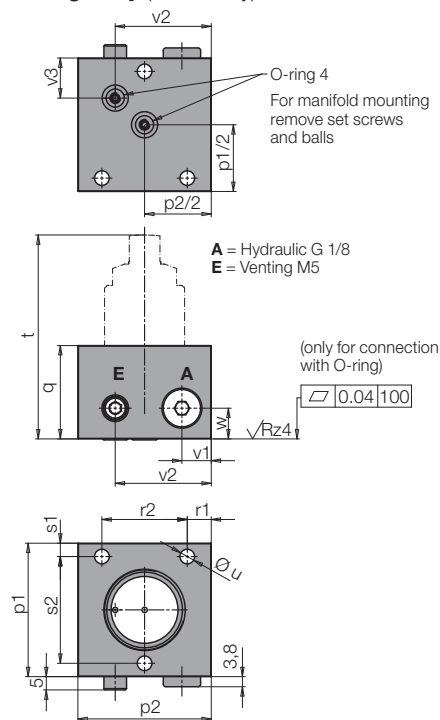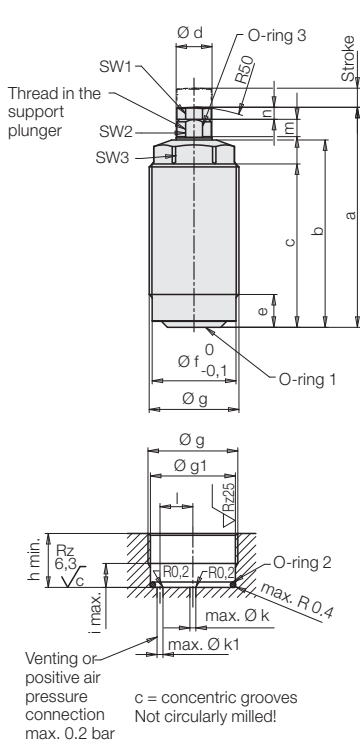

Mounting body complete (Accessory)

In combination with mounting bodies, the threaded-body work supports become individual components ready for installation.

For pipe connection, there are connecting threads G 1/8 and M5 for hydraulics and venting.

A manifold-mounting connection with thrilled channels is also possible. For this purpose, the screw plugs in the manifold-mounting surface will be removed and the supplied O-rings inserted in the counterbores. The pipe connections remain closed. O-rings and screw plugs are included in the delivery.

Load force as a function of the operating pressure

